



# Ideal Inspection

(a division of Ideal Oilfield Construction Ltd.)

P.O Box 1473



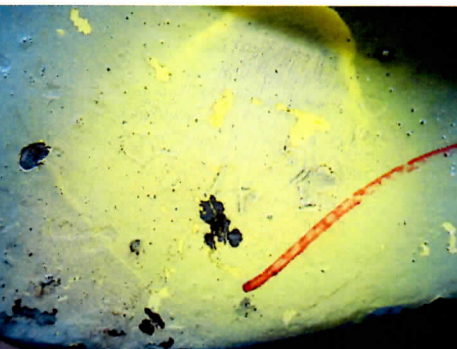
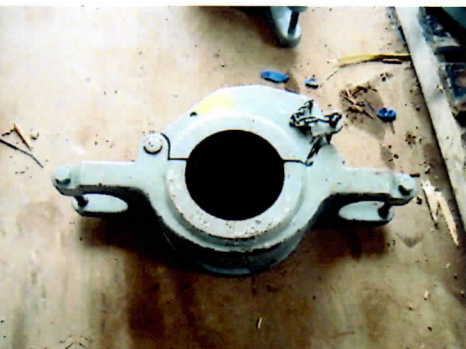

Brooks, Alberta

T1R 1C3

Phone: 403-362-2843

Fax: 403-362-2862

# INSPECTION REPORT

Client: K&S Power Tongs		Location: DaPaJo Construction Limited		Date: May 10, 2013	
P.O. :		Work Order : 2248f		Report : 3839	
Page : 1 of 1		Unit : KS 709	S/N: 071288509	Inspection: Magnetic Particle	
Parts Examined: AOT 7" 65 Ton Side Door Casing Elevator					
Surface Condition: Painted			Material Temperature: 10° Celsius		
Procedure: MPI-DPJ-001			Code: ASME Section V, ASTM E709		
Equipment: Parker B 310 Contour Probe					
Method: Magnetic Particle, AC Continuous, Wet Florescent Method					
Test Medium: Magnaglow 14 HF Florescent Prepared Bath					
Test Results:			Engineer's Approval:		
No defects were found at the time of this inspection.					
Photos:					
					
Technician: John Frances		CGSB #: 7062	Signature: 	Assistant: Tyler Nevison	
Repairs Complete		Yes <input type="checkbox"/>	No <input type="checkbox"/>	N/A <input checked="" type="checkbox"/>	X <input type="checkbox"/>
				Acceptable For Service	
				Yes <input checked="" type="checkbox"/>	X <input type="checkbox"/>
				No <input type="checkbox"/>	<input type="checkbox"/>